




Winkel- Bohr- und Fräskopf

Radial drilling and milling head

Tête de perçage et de fraisage radiale




Darstellung symbolisch
 symbolical drawing
 schéma symbolique

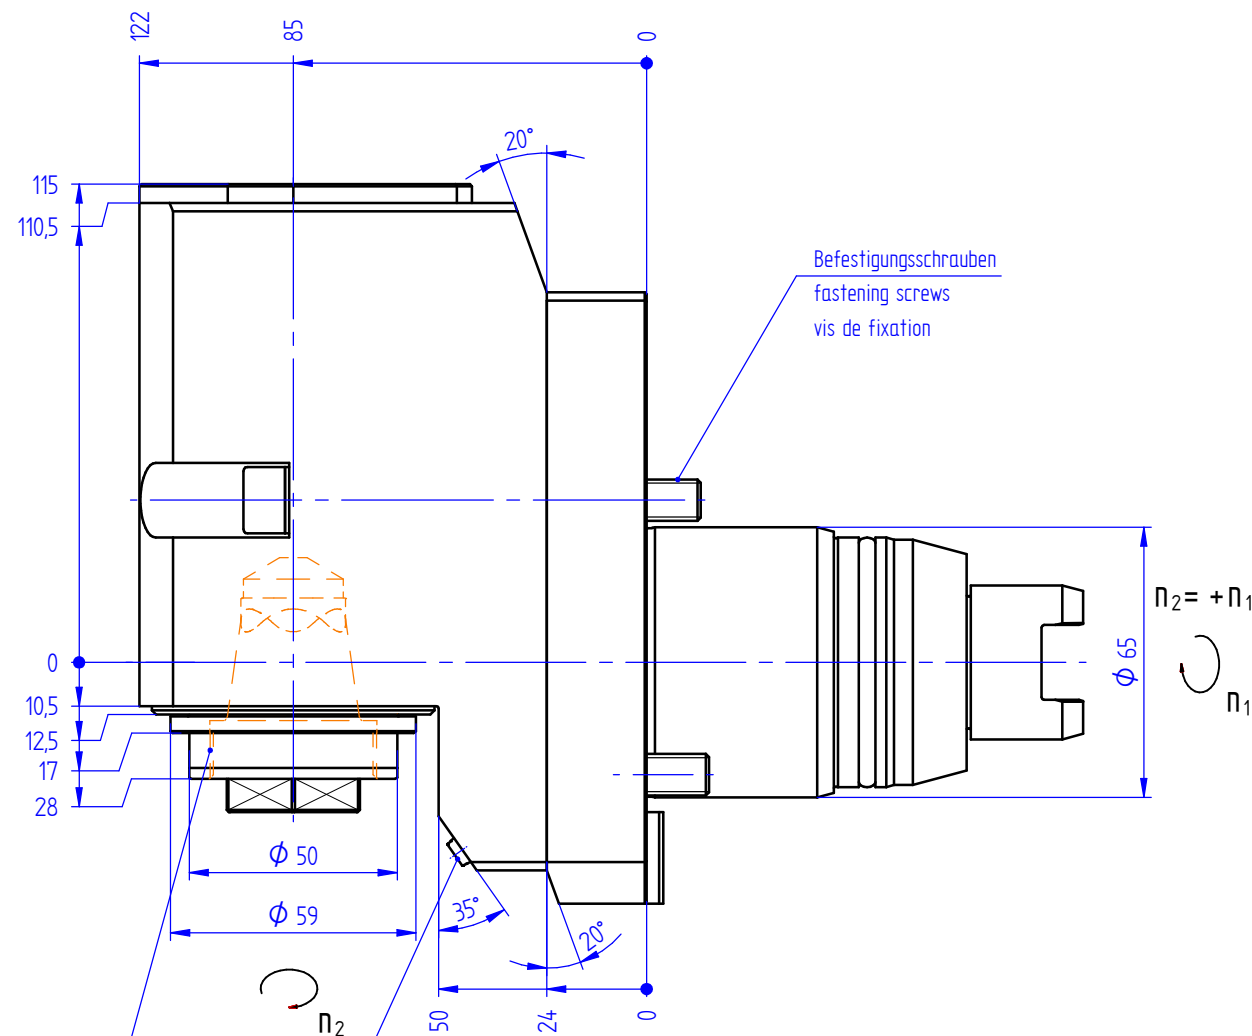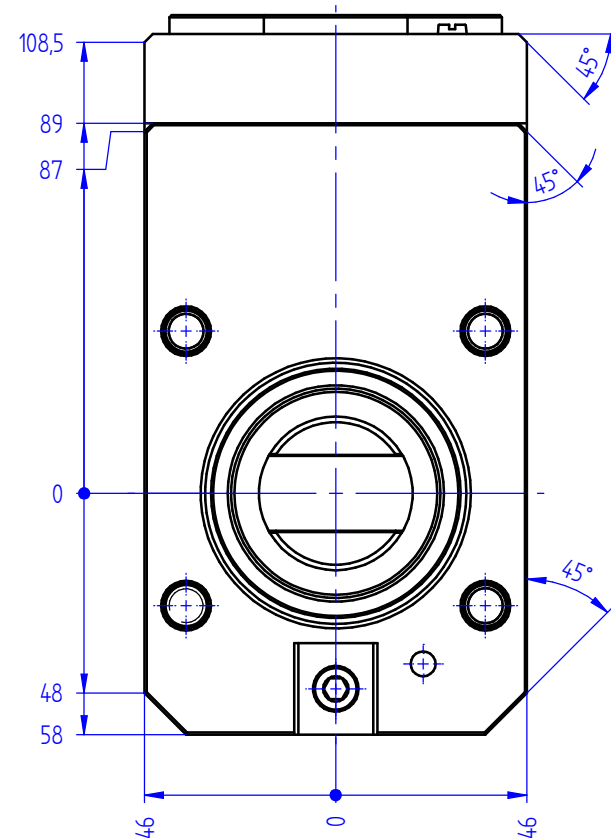

Befestigungsschrauben
 fastening screws
 vis de fixation

$n_2 = +n_1$

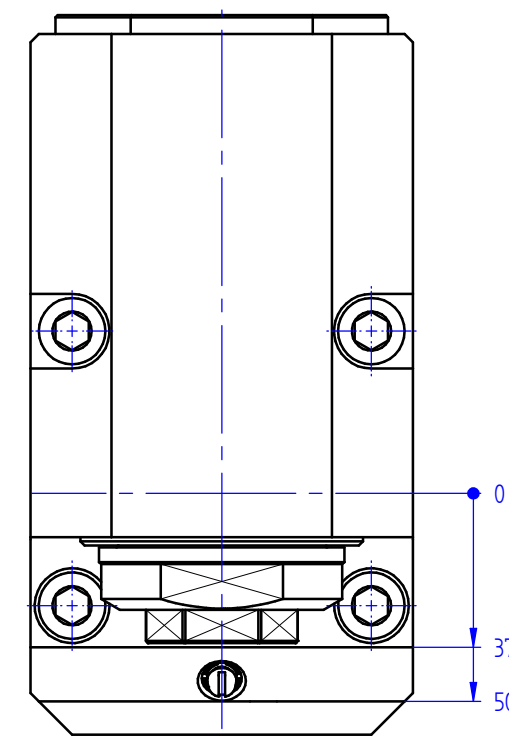

Optionen :
 options :
 options :



Gewindebohrzangen
 tapping collets
 pinces de taraudage



Spannzangen
 collets
 les pinces




Wechseleinsatz u-tec
 insert u-tec
 insert u-tec



Spannmuttern
 clamping nuts
 écrous de serrage




Bedienschlüsselsatz
 set of wrench
 jeu de clés

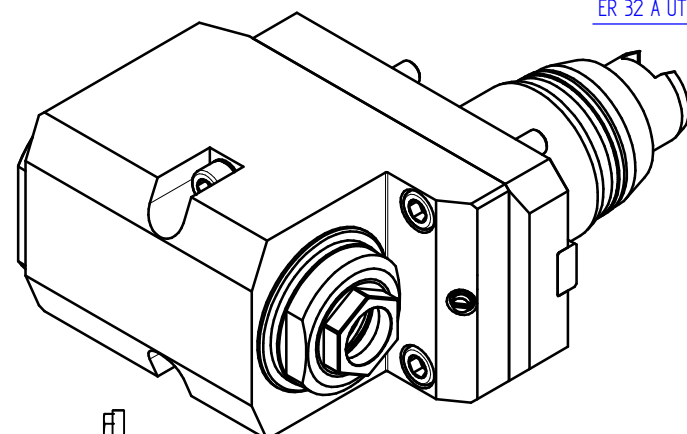

ER 32 A UT (1,0 - 20,0)

bei externer Kühlmittelzufuhr Schraube entfernen
 for external coolant supply, take off screw
 pour arrosage externe, enlevez la vis

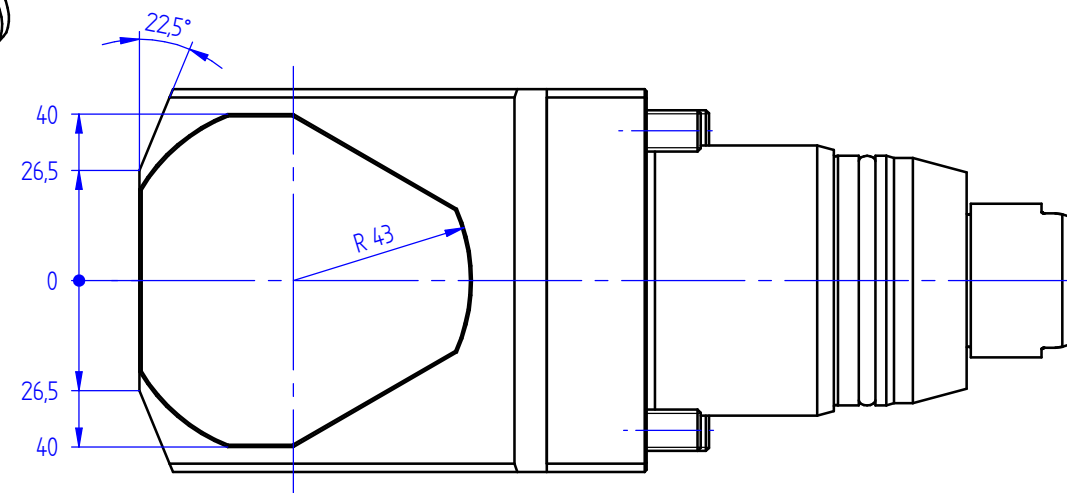

mit innerer Kühlmittelzufuhr für Hochdruck
 internal coolant supply (for high pressure)
 arrosage interne (pour haute pression)

mit kombinierter Kühlmittelzufuhr
 with combined coolant supply
 arrosage combiné

p x n Diagramm D 00 010
 p x n diagram D 00 010
 p x n diagramme D 00 010

p max. [bar] = 140

i = 1:1

M₂ max. [Nm] = 50

n₂ max. [min⁻¹] = 6000

Bestell - Nr.
 ref.no. / Node cde.

8 033 66 012

» weitere Ausführungen auf Anfrage
 other models on request
 autres modèles sur demande
 subject to technical changes

nous nous réservons toutes modifications techniques