


Winkel- Bohr- und Fräskopf

Radial drilling and milling head

Tête de perçage et de fraisage radiale



Darstellung symbolisch
symbolical drawing
schéma symbolique


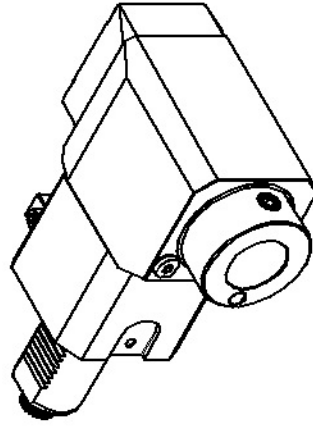


bei externer Kühlmittelfuhr Verschusschraube durch Kührohr ersetzen
using external coolant supply, please substitute lacking screw by coolant tube
pour arrosage externe, remplacez la vis par le tube fileté




n_2

easy-quick HT16

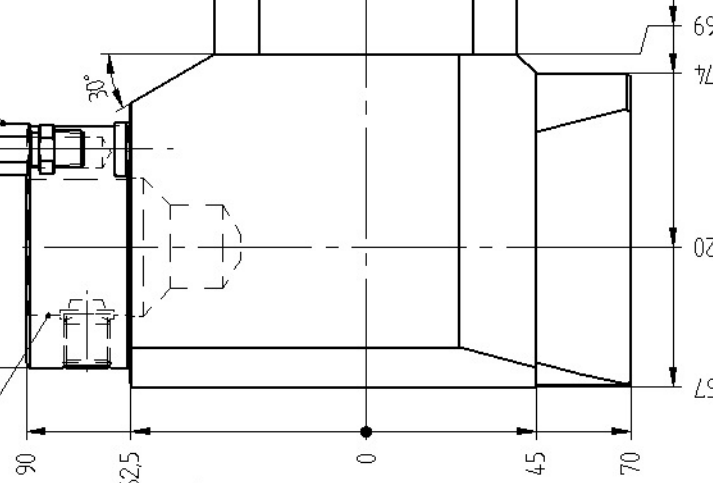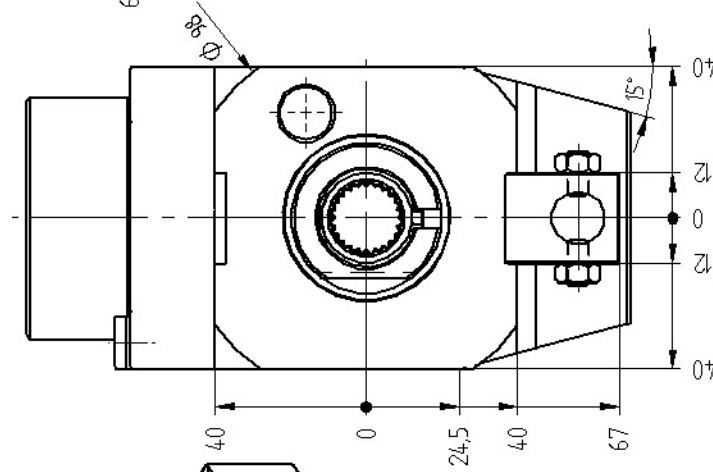

180° umsetzbar
180° convertible
interchangeable de 180°

$$n_2 = -\frac{1}{i} \times n_1$$

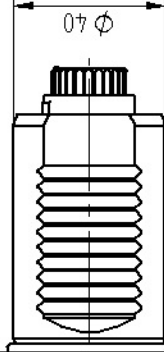

p max.	[bar] =	25
i	=	2:1
M ₂ max.	[Nm] =	63
n ₂ max.	[min ⁻¹] =	4000

Bestell - Nr.


ref.no. / No.de cde.

8 030 48 004

Optionen :
options :
options :



Wechseleinsatz easy-quick
insert easy-quick
insert easy-quick



Bedienchlüssel
wrench
clé

Technische Änderungen vorbehalten

» weitere Ausführungen auf Anfrage
other models on request
autres modèles sur demande
subject to technical changes

nous nous réservons toutes modifications techniques